

Surface Preparation Guide

PRECAUTION! Some of the formulations and solutions suggested below may be dangerous to handle. Please consult with your EHS department and/or vendors of materials for proper use and disposal. Note, it is not suggested or implied that this guide be used as a specification or a necessity when needing to prepare surfaces. In most industrial and manufacturing settings fully surface preparation cannot be achieved. This document is meant to be an informational guide only. Please consult Epoxyset with any questions or concerns with applications or surface preparation.

For high strength structural bonds, paint, oxide films, oils, dust, mould, release agents and all other surface contaminants must be completely removed. However, the amount of surface preparation directly depends on the required bond strength, environmental aging resistance and economic practicalities.

There are three basic methods of removing contaminants: chemical cleaning, abrasion and degreasing.

CHEMICAL CLEANING is popular for preparing metals. It includes treatments which etch the surface to form highly adhering oxides, or deposit complex inorganic coatings. Chemical cleaning, where applicable, provides the best surface for adhesion.

ABRASION METHODS include sandblasting, vapor honing and use of abrasives or "Scotch-Brite" cleaning and finishing materials. Sandblasting with fine sand can only be used on substrates sufficiently thick to prevent distortion. Vapor honing is satisfactory when minimum reduction is desired in metal thickness. In this method, powered abrasive material is propelled by high velocity water or steam against the surface.

DEGREASING may be used when maximum adhesive strength or outdoor weather-resistance is not critical. Surfaces are cleaned with either a hot alkali solution or solvent vapor. To use either method, surfaces must be free of rust, paint and mill scale.

Hot alkali solution is the most effective in removing residual contaminants. Solvent vapor systems are less effective and should be checked frequently for accumulated contaminants.

RECOMMENDED SURFACE PREPARATION PROCEDURES FOR BONDING

The following surface treatments are recommended for preparing various materials for bonding. In general, three (3) steps are necessary for cleaning any surface:

1. Degreasing
2. Chemical etching or mechanical abrading
3. Degreasing

Surface Preparation Guide

For precious metals and jewels, degreasing will generally be entirely satisfactory, with the possible exception of silver where the tarnish should be removed with medium grit emery paper. A stabilized Trichlorethylene vapor phase degreaser is recommended.

Most plastic parts will have residual mould release or wax on the surface; before bonding, this should be removed with a suitable solvent-such as Acetone or Methyl Ethyl Ketone (if necessary)- and then abraded, lightly, with a medium-grit emery paper.

When mechanically abrading, we recommend the use of medium-grit blasting. It is essential, when parts are grit or sandblasted, that they be degreased again before bonding. In all cases, parts should be bonded as soon as possible after pre-treatment. If bonding must be delayed, we recommend that the parts be covered with a light tissue paper and stored in a non-contaminating, dry atmosphere.

Following are several chemical pre-treating formulas recommended for the most common adherents (for industrial use only). All recommendations or suggestions for use are made without guarantee-in as much as conditions of use are beyond our control.

ALUMINIUM, ALCLAD OR 24ST

1. Degrease with a solvent and dry.
2. Clean the surface with a chromic acid solution*** by immersion at 65-70 degrees C for 5-10 minutes.
3. Rinse the metal thoroughly with clear running water and dry well. (If compressed air is used, extreme care should be taken to see that no oil is sprayed on the surface from the compressed air system.)
4. For best results, parts should be coated or bonded immediately.

*****Prepare the chromic acid solution as follows:**

- 10 parts/wt. Sodium Dichromate.
- 30 parts/wt. 96% Sulphuric Acid.
- 100 parts/wt. distilled water.

(Dissolve the Dichromate in most of the water, add Sulfuric Acid, stirring carefully and then add the remaining water.)

CAST IRON

Degrease. Grit-blast or abrade with emery paper. Degrease again.

Surface Preparation Guide

CONCRETE (Portland Cement Type)

1. Concrete contaminated with oil or grease must first be scrubbed with a caustic solution such as Ammonium Hydroxide followed by a thorough flushing with water.
2. New or old concrete should be prepared for bonding by one of the following methods:
 - (a) Sand-blast about 1/16" from the surfaces to be bonded and remove dust preferably by vacuum-cleaner. Where concrete surface has deteriorated, grind or cut down to good material and remove dust.
 - (b) Remove about 1/8" from the surface by mechanical scarification and remove dust.
 - (c) Chemically etch with a 15% by weight, Hydrochloric Acid solution (1 gallon to every 5 square yards-spread with stiff bristle street brooms) until bubbling subsides (about every 15 minutes). Wash with clean water using high pressure hose until all slush is removed. If an acid condition persists, as indicated by moist litmus paper, a rinse of 1% by weight, Ammonia solution should be applied followed by a final flush. Allow surface to dry thoroughly.

COPPER AND ITS ALLOYS (Brass)

- 430 parts/volume Sulphuric Acid.
- 72 parts/volume Nitric Acid.
- 490 parts/volume water.

Procedure: Dip 15 seconds in above solution, rinse in running tap water (25C) five seconds, dip in 15% (volume) Hydrochloric Acid, followed by a 2-minute rinse in running tap water (25C).

The following formula may be used:

- 8.0 parts/wt. Ferric chloride solution.
- 16.3 parts/wt. Nitric Acid.
- 75.7 parts/wt. water.

Immerse the parts 1-2 minutes at room temperature, followed by a thorough water rinse and air dry at 60-65C.

DIALLYL PHTHALATE

Degrease with a rag containing Acetone or M.E.K. Abrade the surface with medium-grit emery paper. Degrease again with Acetone or M.E.K.

Surface Preparation Guide

GALVANISED OR ZINC FINISHED METALS

Degrease. Abrade with medium-grit emery paper. Degrease again or use the following etching procedure:

- 20 parts/wt. concentrated Hydrochloric Acid
- 80 parts/wt. distilled water.

Treat as follows:

1. Degrease.
2. Immerse the metal in the Hydrochloric Acid for 2-4 minutes at room temperature.
3. Rinse in cold running, distilled or de-ionized water.
4. Dry in an oven for 20-30 minutes at 60-70 degrees C.
5. Apply adhesive as soon as possible.

GLASS

For normal bonding applications, degreasing alone is sufficient for pre-treating glass surfaces. If, however, the very optimum in strength is required, the glass can be grit-blasted with very fine grit until the surface appears frosted.

LEAD

Degrease. Abrade with medium-grit emery paper. Degrease again.

LEATHER

Degrease with a rag containing Acetone or M.E.K. Roughen with sandpaper. Degrease again.

MAGNESIUM AND ITS ALLOYS

1. Vapour degrease with stabilised Trichlorethylene.
2. Immerse in 10% Sodium Hydroxide for 10 minutes at 76-87C.
3. Rinse 5 minutes in a cold water spray.
4. Immerse in a solution of 1 1/2 lbs. Chromic Acid, 1/4 lb. Sodium Nitrate in 1 gallon of water for 8 minutes at room temperature.
5. Rinse approximately 3 minutes.
6. Immerse in a 20% solution of Hydrofluoric Acid for 5 minutes at room temperature.
7. Rinse 1/2 - 1 minute.

Surface Preparation Guide

8. Immerse in a boiling solution of 10-15% Sodium Dichromate and 0.15% Calcium Fluoride for 30 minutes.
9. Rinse 1-2 minutes.
10. Dry in hot air blast (71-98 degrees C) for 10 minutes.
11. Bond immediately or apply a Zinc primer for protection of freshly etched surfaces.

SILICONE STEEL

8.0 parts/wt. Hydrochloric Acid

7.8 parts/wt. Sulphuric Acid

84.2 parts/wt. Nitric Acid

The parts should be immersed in the above solution (maintained at 70-75C) for 10-20 minutes, then rinsed with water at room temperature and brushed with a soap solution to mechanically remove scale loosened by the chemical bath. A hot water rinse (70-75 degrees C) followed by a hot air dry (70-75 degrees C) completes the preparation.

STAINLESS STEEL

1. Degrease.
2. Etch for 10 minutes at 65-68 degrees C. in a solution*
3. Rinse in tap water or distilled water.
4. Immerse for 10 minutes at room temperature in a water solution***
5. Rinse in distilled water and dry in 95 degrees C. oven.

Solution One*

- 90 parts/wt. water.
- 37 parts/wt. 96% Sulphuric Acid.
- 0.2 parts/wt. Nacconol NR (National Aniline)

Solution Two***

- 88 parts/wt. water.
- 15 parts/wt. concentrated Nitric Acid.
- 2 parts/wt. Hydrofluoric Acid.

TEFLON

Surface Preparation Guide

Formulas for etching solutions are available; however, because of the danger in the preparation and use of these materials, we recommend that you buy proprietary materials available from the companies listed below:

- W.L Gore Associates, Newark Delaware - (Tetraetch)
- Acton Associates, Newark New Jersey - (Fluoroetch)
- Joclin Manufacturing Co. Wallingford, Conn. - (Fluorobond)

Teflon and other fluorocarbon plastics are available in bondable form from many suppliers.

PHENOLIC, POLYESTER & POLYURETHANE RESINS

Degrease with a rag containing Acetone or M.E.K. Abrade with medium-grit emery paper. Degrease again.

RUBBER

Surface etching of rubber is recommended for maximum bond strength. A satisfactory bonding surface can be obtained by using the following cyclizing technique:

Immerse the rubber in concentrated Sulphuric Acid (sp. gr. 1.84) for 5-10 minutes in the case of natural rubber and 10-15 minutes in the case of synthetic rubber. Many rubbers are very acid resistant and will require longer cyclizing times to reach a point where the rubber will have fine cracks when flexed.

Alternatively, a paste of concentrated Sulphuric Acid and Barytes can be used. The paste is made by adding Barytes to the acid to give a consistency which will not run. After washing thoroughly with water and drying, the brittle surface of the rubber should be broken by flexing so that a finely cracked surface is produced. It may be necessary to wash with dilute caustic solution to insure neutralization of residual acid which, if not removed, will consume some of the curing agent weakening the bond strength. The surface is then ready for application of the adhesive.

TIN

Degrease. Abrade with medium-grit emery paper. Degrease again.

TITANIUM

In general, an acid etch is the most effective surface treatment for titanium. Anodizing in 15% Sulphuric Acid or etching in hot Sulphuric Acid solution followed by cleaning in Alkanex detergent-sodium metasilicate solution produces good results. Still better results are obtained in the titanium surface is first plated with a metal such as aluminum or nickel.



ISO-9001-2015 Certified

Surface Preparation Guide

WOOD

Remove any contaminating materials such as oil, rot, etc., with a sander, ax, or plane. Make certain the wood is dry. Smooth with sand-paper.